



# INDUCTORS

## Instructional Guide



### INDUCTORS 101



#### TABLE OF CONTENTS

- Introduction
- Magnetic Core Types
- Core Materials
- Electrical Specifications
- Inductor Technologies
- Factors Affecting Performance
- Electrical Relationships
- Inductor Applications

#### RESOURCES

For technical information, contact [magnetics@vishay.com](mailto:magnetics@vishay.com)



## Inductors

A passive component designed to resist changes in current. Inductors are often referred to as “AC resistors”. The ability to resist changes in current and store energy in its magnetic field account for the bulk of the useful properties of inductors. Current passing through an inductor will produce a magnetic field. A changing magnetic field induces a voltage which opposes the field-producing current. This property of impeding changes of current is known as inductance. The voltage induced across an inductor by a change of current is defined as:

$$V = L \, di/dt$$

Thus, the induced voltage is proportional to the inductance value and the rate of current change.

## Magnetic Core Types

### Toroidal Core

An inductor constructed by placing a winding(s) on a core that has a donut shaped surface. Toroidal cores are available in many magnetic core materials within the four basic types: ferrite, powdered iron, alloy and high flux, and tape wound. Characteristics of toroidal inductors include: self shielding (closed magnetic path), efficient energy transfer, high coupling between windings and early saturation.

### “E” Core

“E” cores are shaped like an “E” and have a closed magnetic path like a toroidal core when configured as ungapped. The gapped “E” cores have a partially open magnetic path. The advantage of gapping an “E” core is that you can obtain higher inductance values before reaching saturation.

## Core Materials

### Ceramic Cores

Ceramic is one of the common materials used for inductor cores. Its main purpose is to provide a form for the coil. In some designs it also provides the structure to hold the terminals in place. Ceramic has a very low thermal coefficient of expansion. This allows for relatively high inductance stability over the operating temperature ranges. Ceramic has no magnetic properties. Thus, there is no increase in permeability due to the core material. Ceramic core inductors are often referred to as “air core” inductors. Ceramic core inductors are most often used in high-frequency applications where low inductance values, very low core losses, and high Q values are required.

### Ferrite Core

Ferrite is a magnetic material which consists of a mixed oxide of iron and other elements that are made to have crystalline molecular structure. The crystalline structure is created by firing the ferrite material at a very high temperature for a specified amount of time and profile. The general composition of ferrites is  $xxFe_2O_4$  where xx represents several metals. The most popular metal combinations are manganese and zinc (MnZn), and nickel and zinc (NiZn). These metals can be easily magnetized.

### Kool Mu® Core

Kool Mu® is a magnetic material that has an inherent distributed air gap. The distributed air gap allows the core to store higher levels of magnetic flux when compared to other magnetic materials, such as ferrites. This characteristic allows a higher DC current level to flow through the inductor before the inductor saturates. Kool Mu material is an alloy that is made up of nickel and iron powder (approx. 50 % of each) and is available in several permeabilities. It has a higher permeability than powdered iron and lower core losses. Kool Mu performs well in power switching applications. The relative cost is significantly higher than powdered iron.

### MPP Core

MPP is an acronym for molypermalloy powder. It is a magnetic material that has an inherent distributed air gap. The distributed air gap allows the core to store higher levels of magnetic flux when compared to other magnetic materials, such as ferrites. This characteristic allows a higher DC current level to flow through the inductor before the inductor saturates. The basic raw materials are nickel, iron, and molybdenum. MPP stores higher amounts of energy and has a higher permeability than Kool Mu. The core characteristics allow inductors to perform very well in switching power applications. Since higher energy can be stored by the core. The cost of MPP is significantly higher than Kool Mu, powdered irons, and most ferrite cores with similar sizes.



## Powdered Iron Core

Powdered iron is a magnetic material that has an inherent distributed air gap. The distributed air gap allows the core to store higher levels of magnetic flux when compared to other magnetic materials, such as ferrites. This characteristic allows a higher DC current level to flow through the inductor before the inductor saturates. Powdered iron cores are made of nearly 100 % iron. The iron particles are insulated from each other, mixed with a binder (such as phenolic or epoxy) and pressed into the final core shape. Powdered iron cores are typically the lowest cost alternative and their permeabilities typically have a more stable temperature coefficient than ferrites.

## Laminated Cores

Cores constructed by stacking multiple laminations on top of each other. The laminations are offered in a variety of materials and thicknesses. Some laminations are made to have the grains oriented to minimize the core losses and give higher permeabilities. Each lamination has an insulated surface which is commonly an oxide finish. Laminated cores are used in some inductor designs but are more common in a wide variety of transformer applications.

## Electrical Specifications

### Inductance

That property of a circuit element which tends to oppose any change in the current flowing through it. The inductance for a given inductor is influenced by the core material, core shape and size, the turns count, and the shape of the coil. Inductors most often have their inductances expressed in microhenries ( $\mu\text{H}$ ). The following table can be used to convert units of inductance to microhenries. Thus, 47 mH would equal 47,000  $\mu\text{H}$ .

1 henry (H) =  $10^6$   $\mu\text{H}$

1 millihenry (mH) =  $10^3$   $\mu\text{H}$

1 microhenry ( $\mu\text{H}$ ) = 1  $\mu\text{H}$

1 nanohenry (nH) =  $10^{-3}$   $\mu\text{H}$

### DCR (DC Resistance)

The resistance of the inductor winding measured with no alternating current. The DCR is most often minimized in the design of an inductor. The unit of measure is ohms, and it is usually specified as a maximum rating.

### Saturation Current

The DC bias current flowing through the inductor which causes the inductance to drop by a specified amount from the initial zero DC bias inductance value. Common specified inductance drop percentages include 10 % and 20 %. It is useful to use the 10 % inductance drop value for ferrite cores and 20 % for powdered iron cores in energy storage applications. The cause of the inductance to drop due to the DC bias current is related to the magnetic properties of the core. The core, and some of the space around the core, can only store a given amount of magnetic flux density. Beyond the maximum flux density point, the permeability of the core is reduced. Thus, the inductance is caused to drop. Core saturation does not apply to "air-core" inductors. (Also see Incremental Current and Permeability)

### Incremental Current

The DC bias current flowing through the inductor which causes an inductance drop of 5 % from the initial zero DC bias inductance value. This current level indicates where the inductance can be expected to drop significantly if the DC bias current is increased further. This applies mostly to ferrite cores in lieu of powdered iron. Powdered iron cores exhibit "soft" saturation characteristics. This means their inductance drop from higher DC levels is much more gradual than ferrite cores. The rate at which the inductance will drop is also a function of the core shape. (Also see Saturation Current)

### Rated Current

The level of continuous DC current that can be passed through the inductor. This DC current level is based on a maximum temperature rise of the inductor at the maximum rated ambient temperature. The rated current is related to the inductor's ability to minimize the power losses in the winding by having a low DC resistance. It is also related to the inductor's ability to dissipate this power lost in the windings. Thus, the rated current can be increased by reducing the DC resistance or increasing the inductor size. For low frequency current waveforms, the RMS current can be substituted for the DC rated current. The rated current is not related to the magnetic properties of the inductor. (Also see Incremental Current and Saturation Current)



## Permeability (Core)

The permeability of a magnetic core is the characteristic that gives the core the ability to concentrate lines of magnetic flux. The core material, as well as the core geometry, affect the core's "effective permeability". For a given core shape, size and material, and a given winding, higher permeability magnetic materials result in higher inductance values as opposed to lower permeability materials.

## SRF (Self-Resonant Frequency)

The frequency at which the inductor's distributed capacitance resonates with the inductance. It is at this frequency that the inductance is equal to the capacitance and they cancel each other. The inductor will act purely resistive, with a high impedance at the SRF point. The distributed capacitance is caused by the turns of wire layered on top of each other and around the core. This capacitance is in parallel to the inductance. At frequencies above the SRF, the capacitive reactance of the parallel combination will become the dominant component. Also, the Q of the inductor is equal to zero at the SRF point since the inductive reactance is zero. The SRF is specified in MHz and is listed as a minimum value on product data sheets. (Also see Distributed Capacitance)

## Distributed Capacitance

In the construction of an inductor, each turn of wire or conductor acts as a capacitor plate. The combined effects of each turn can be represented as a single capacitance known as the distributed capacitance. This capacitance is in parallel with the inductor. This parallel combination will resonate at some frequency which is called the self-resonant frequency (SRF). Lower distributed capacitances for a given inductance value will result in a higher SRF value for the inductor and vice versa. (Also see SRF)

## Q

The Q value of an inductor is a measure of the relative losses in an inductor. The Q is also known as the "quality factor" and is technically defined as the ratio of inductive reactance to effective resistance, and is represented by:

$$Q = \frac{X_L}{R_e} = \frac{2\pi fL}{R_e}$$

Since  $X_L$  and  $R_e$  are functions of frequency, the test frequency must be given when specifying Q.  $X_L$  typically increases with frequency at a faster rate than  $R_e$  at lower frequencies, and vice versa at higher frequencies. This results in a bell-shaped curve for Q vs frequency.  $R_e$  is mainly comprised of the DC resistance of the wire, the core losses and skin effect of the wire. Based on the above formula, it can be shown that the Q is zero at the self-resonant frequency since the inductance is zero at this point.

## Impedance

The impedance of an inductor is the total resistance to the flow of current, including the AC and DC component. The DC component of the impedance is simply the DC resistance of the winding. The AC component of the impedance includes the inductor reactance. The following formula calculates the inductive reactance of an ideal inductor (i.e., one with no losses) to a sinusoidal AC signal:

$$Z = X_L = 2\pi fL$$

L is in henries and f is in hertz. This equation indicates that higher impedance levels are achieved by higher inductance values or at higher frequencies. Skin effect and core losses also add to the impedance of an inductor. (Also see Skin Effect and Core Losses)

## Operating Temperature Range

Range of ambient temperatures over which a component can be operated safely. The operating temperature is different from the storage temperature in that it accounts for the component's self temperature rise caused by the winding loss from a given DC bias current. This power loss is referred to as the "copper" loss and is equal to:

$$\text{Power Loss} = (DCR) (I_{dc}^2)$$



# INDUCTORS

## Instructional Guide



### Inductor Technologies

#### Wirewound

- Bobbin
- Toroidal


#### Multilayer ferrite

- Bead
- Inductor


#### Multilayer ceramic

#### Film



#### Laser cut

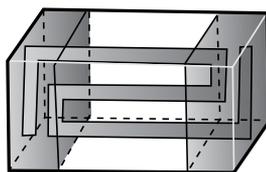

Single layer

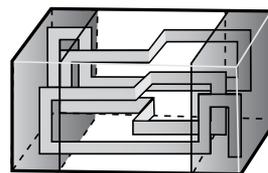

Multilayer

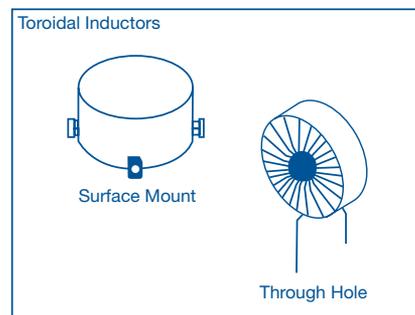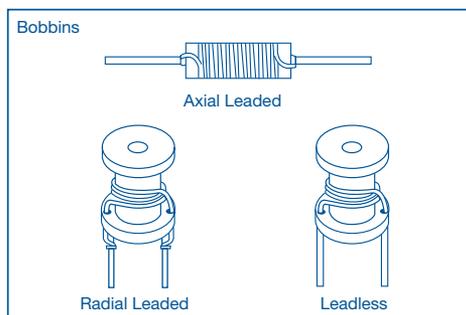

### Factors Affecting Performance

#### Copper Loss

The power lost by current flowing through the winding. The power loss is equal to the square of the current multiplied by the resistance of the wire ( $I^2 R$ ). This power loss is transferred into heat.

#### Core Losses

Core losses are caused by an alternating magnetic field in the core material. The losses are a function of the operating frequency and the total magnetic flux swing. The total core losses are made up of three main components: hysteresis, eddy current and residual losses. These losses vary considerably from one magnetic material to another. Applications such as higher power and higher frequency switching regulators and RF designs require careful core selection to yield the highest inductor performance by keeping the core losses to a minimum.

#### Eddy Current Losses

Eddy current losses are present in both the magnetic core and winding of an inductor. Eddy currents in the winding (or conductor) contribute to two main types of losses:

- Losses due to proximity effects
- Skin effects.

As for the core losses, an electric field around the flux lines in the magnetic field is generated by alternating magnetic flux. This will result in eddy currents if the magnetic core material has electrical conductivity. Losses result from this phenomenon since the eddy currents flow in a plane that is perpendicular to the magnetic flux lines.

#### Skin Effect

Skin effect is the tendency for alternating current to flow near the surface of the conductor in lieu of flowing in a manner that utilizes the entire cross-sectional area of the conductor. This phenomenon causes the resistance of the conductor to increase. The magnetic field associated with the current in the conductor causes eddy currents near the center of the conductor which opposes the flow of the main current near the center of the conductor. The main current flow is forced further to the surface as the frequency of the alternating current increases. (Also see Litz Wire)

#### Litz Wire

Wire consisting of a number of separately insulated strands that are woven or bunched together such that each strand tends to take all possible positions in the cross section of the wire as a whole. The current through each individual strand



is divided equally since this wire design equalizes the flux linkages and reactance of the individual strands. In other words, a Litz conductor has lower AC losses than comparable solid-wire conductors, which becomes important as the operating frequency increases. (See also Skin Effect)

### Curie Temperature

The temperature above which a ferrite core loses its magnetic properties. The core's permeability typically increases dramatically as the core temperature approaches the curie temperature, which causes the inductance to increase. The permeability drops to near unity at the curie temperature, which causes the inductance to drop dramatically. The curie point is the temperature at which the initial permeability has dropped to 10 % of its original value at room temperature.

## Electrical Relationships

### DCR

On a given design, as inductance (turns of wire) goes up, so does the DCR.

If the permeability of the core is increased, the number of windings can be reduced, and DCR will go down.

### Rated Current

On a given design, as inductance (turns of wire) goes up the rated current goes down.

If the permeability of the core is increased, the number of windings can be reduced and rated current will go up.

### Incremental Current

On a given design, as inductance (turns of wire) goes up, the incremental current goes down.

If the permeability of the core is increased, the number of windings can be reduced and incremental current may increase or decrease.\*

\*If the increased permeability decreases the point at which the core saturates, the actual incremental current can go down.

### SRF

On a given design, as inductance (turns of wire) goes up, the distributed capacitance will also go up, and the SRF will go down.

If the permeability of the core is increased, the number of windings can be reduced, and SRF will increase (less distributed capacitance).

### “Q”

On a given design, as inductance (turns of wire) goes up, the Q goes down.

If the permeability of the core is increased, the number of windings can be reduced and incremental current may increase or decrease.\*

A higher Q generally indicates an inductor that is a more selective filter. Inductors used in RF circuits usually have high Q's so they can be more frequency selective.


A lower Q generally indicates an attenuation over a broader range of frequencies. A ferrite bead has a low Q and is thus considered a broadband filter.

\*Increased permeability can result in the  $R_e$  increasing at certain frequencies resulting in a lower Q.

## Inductor Applications


### Buck Regulator (DC-DC)

A basic dc-to-dc switching converter topology that takes an unregulated input voltage, and produces a lower, regulated output voltage. This output voltage is achieved by chopping the input voltage with a series of connected switches (transistor) that apply pulses to an averaging inductor and capacitor circuit.

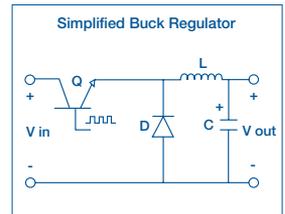


### Boost Regulator (DC-DC)

A basic dc-to-dc switching converter topology that takes an unregulated input voltage, and produces a higher, regulated output voltage. This higher output voltage is achieved by storing energy in an input inductor and then transferring the energy to the output by turning a shunt switch (transistor) on and off.

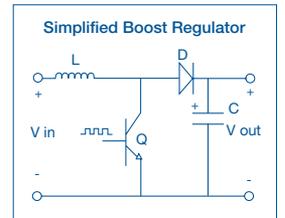

### Common-Mode Choke

Used to attenuate common mode noise or electrical interference that is common to both electrical lines in relation to earth ground. A common mode choke is actually a transformer configured to have the common noise cancel itself in the transformer.

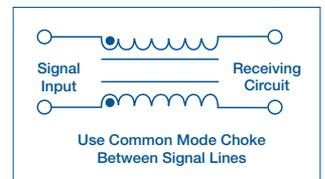


### Filter

A circuit or device whose purpose is to control electrical energy at a given frequency or over a range of frequencies. Groups of passive components are commonly used to construct many types of filters. These passive components include resistors, capacitors and inductors.

### PI-Filter

A filter consisting of two capacitors connected in parallel with a series inductor. These filters are commonly found near dc-to-dc converters to filter ripple current and voltage.

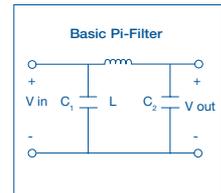

### Input Line Filter

A power filter placed on the input to a circuit or assembly that attenuates noise introduced from the power bus. The filter is designed to reject noise within a frequency band. Typically, these filters are low-pass filters, meaning they pass low frequency signals such as the DC power, and attenuate higher frequency signals which consist mainly of noise. Band pass, or low pass filters, are commonly made up of inductor and capacitor combinations.

### Matched Impedance

The condition that exists when two coupled circuits are adjusted so that the output impedance of one circuit equals the input impedance of the other circuit. There is a minimum power loss between two circuits when their connecting impedances are equal.

### EMI

EMI is an acronym for electromagnetic interference. It is unwanted electrical energy in any form. EMI is often used interchangeably with "noise". Ferrite beads are the most common device used for EMI attenuation.

### Noise

Unwanted electrical energy in a circuit that is unrelated to the desired signal. Sources of noise are most often generated by some type of switching circuit. Common sources include switching voltage regulators and clocked signals, such as digital circuits.



## WORLDWIDE SALES CONTACTS

### THE AMERICAS

#### UNITED STATES

VISHAY AMERICAS  
ONE GREENWICH PLACE  
SHELTON, CT 06484  
UNITED STATES  
PH: +1-402-563-6866  
FAX: +1-402-563-6296

### ASIA

#### SINGAPORE

VISHAY INTERTECHNOLOGY ASIA PTE LTD.  
37A TAMPINES STREET 92 #07-00  
SINGAPORE 528886  
PH: +65-6788-6668  
FAX: +65-6788-0988

#### P.R. CHINA

VISHAY CHINA CO., LTD.  
15D, SUN TONG INFOPORT PLAZA  
55 HUAI HAI WEST ROAD  
SHANGHAI 200030  
P.R. CHINA  
PH: +86-21-5258 5000  
FAX: +86-21-5258 7979

#### JAPAN

VISHAY JAPAN CO., LTD.  
SHIBUYA PRESTIGE BLDG. 4F  
3-12-22, SHIBUYA  
SHIBUYA-KU  
TOKYO 150-0002  
JAPAN  
PH: +81-3-5466-7150  
FAX: +81-3-5466-7160

### EUROPE

#### GERMANY

VISHAY ELECTRONIC GMBH  
DR.-FELIX-ZANDMAN-PLATZ 1  
95100 SELB  
GERMANY  
PH: +49-9287-71-0  
FAX: +49-9287-70435

#### FRANCE

VISHAY S.A.  
199, BD DE LA MADELEINE  
06003 NICE, CEDEX 1  
FRANCE  
PH: +33-4-9337-2727  
FAX: +33-4-9337-2726

#### UNITED KINGDOM

VISHAY LTD.  
SUITE 6C, TOWER HOUSE  
ST. CATHERINE'S COURT  
SUNDERLAND ENTERPRISE PARK  
SUNDERLAND SR5 3XJ  
UNITED KINGDOM  
PH: +44-191-516-8584  
FAX: +44-191-549-9556