




Soldering Guidelines for Film Capacitors

Vishay recommends that users observe the following guidelines for soldering our film capacitors. Adherence to these recommendations will help to safeguard product specifications and reliability while preventing damage to the capacitors during soldering.


SOLDERING GUIDELINES AND RECOMMENDED WAVE SOLDERING PROFILE

With regard to the resistance to soldering heat and the solderability, our products comply with "IEC 60384-1" and the additional type specifications.

The recommended wave soldering profile for our leaded components is defined as follows:

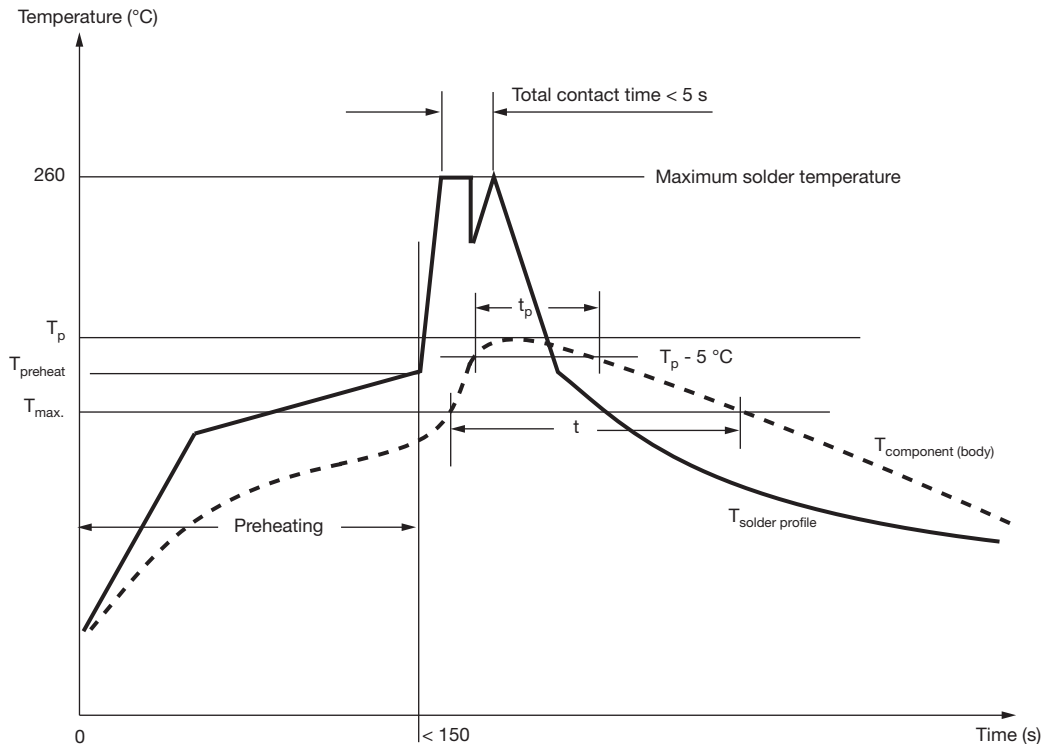

T_p : Peak temperature of the component body (top)
 $T_{max.}$: Maximum application temperature of the component

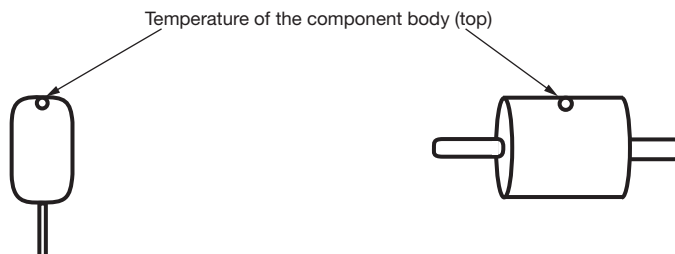



Soldering Guidelines for Film Capacitors

The PSL (Process Sensitivity Level) is classified according JEDEC standard J-STD-075 “Classification of Non-IC Electronic Components for Assembly Processes” and summarized in following tables per product family and pitch size of the component:

RADIAL POLYESTER TYPES

FAMILY	PRODUCT PITCH SIZE							
	5 mm	7.5 mm	10 mm	15 mm	22.5 mm	27.5 mm	37.5 mm	52.5 mm
MKT 303			W4C (1)(3)	W4C (1)(3)				
MKT 365	W4Y (2)(4)	W4Y (2)(4)						
MKT 366	W4Y (2)(4)	W4Y (2)(4)						
MKT 367	W4Y (2)(4)	W4Y (2)(4)						
MKT 368			W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)		
MKT 369			W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)		
MKT 370	W4Y (2)(4)							
MKT 371		W4Y (2)(4)						
MKT 372			W4C (1)(3)					
MKT 373/MKT 373M				W4C (1)(3)	W4C (1)(3)	W4C (1)(3)		
MKT 468			W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)		
MKT 470	W4Y (2)(4)							
MKT 1817	W4Y (2)(4)							
MKT 1818		W4Y (2)(4)						
MKT 1820			W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	
MKT 1822			W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	
MKT 1710			W4C (1)(3)	W4C (1)(3)				
MKT 1772				W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	W4C (1)(3)	

Notes

- (1) No risk
- (2) Risk for parameter change if PSL is not strictly followed
- (3) C: The component has a preheat limitation of 150 °C
- (4) Y: Temperature is measured at the body top and must be kept as follows:
 During preheating: $T_{max} \leq 125 \text{ }^\circ\text{C}$
 During soldering: $T_p \leq 135 \text{ }^\circ\text{C}$, $t_p \leq 30 \text{ s}$, $t \leq 50 \text{ s}$



Soldering Guidelines for Film Capacitors

RADIAL POLYPROPYLENE TYPES

FAMILY	PRODUCT PITCH SIZE							
	5 mm	7.5 mm	10 mm	15 mm	22.5 mm	27.5 mm	37.5 mm	52.5 mm
MKP 375				W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 376				W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 378				W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 379			W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 380	W4Y (3)(4)							
MMKP 383				W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 385			W4Y (2)(5)	W4C (1)(6)				
MKP 416/MKP 417/MKP 418/ MKP 419/MKP 420	W4Y (3)(4)	W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 422	W4Y (3)(4)							
MKP 336 1			W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 336 2			W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 336 6			W4Y (2)(5)	W4C (1)(6)				
MKP 338 1			W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 338 2		W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 338 4				W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 338 6		W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 339		W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 339M		W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)
MKP 339T		W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 479			W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)		
MKP 1778			W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	W4C (1)	
KP1830	W4Y (3)(4)							
MKP 1840/MKP 1840M		W4Y (3)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	
MKP 1841/MKP 1841M	W4Y (2)(4)	W4Y (2)(5)	W4Y (2)(5)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	W4C (1)(6)	
MKP 1848						W4C (1)(6)	W4C (1)(6)	W4C (1)(6)

Notes

- (1) No risk
- (2) Risk for parameter change if PSL is not strictly followed
- (3) Risk for product damage if PSL is not strictly followed
- (4) Y: Temperature is measured at the body top and must be kept as follows:
During preheating: $T_{max.} \leq 100\text{ }^{\circ}\text{C}$
During soldering: $T_p \leq 110\text{ }^{\circ}\text{C}$, $t_p \leq 20\text{ s}$, $t \leq 30\text{ s}$
- (5) Y: Temperature is measured at the body top and must be kept as follows:
During preheating: $T_{max.} \leq 110\text{ }^{\circ}\text{C}$
During soldering: $T_p \leq 120\text{ }^{\circ}\text{C}$, $t_p \leq 20\text{ s}$, $t \leq 30\text{ s}$
- (6) C: The component has a preheat limitation of $150\text{ }^{\circ}\text{C}$

Soldering Guidelines for Film Capacitors

AXIAL POLYESTER TYPES

FAMILY	PRODUCT BODY LENGTH					
	11 mm	14 mm	19 mm	26.5 mm	31.5 mm	41.5 mm
MKT 1813	W4Y (3)(5)	W4Y (3)(5)	W4C (2)(4)	W4C (1)(4)	W4C (1)(4)	W4C (1)(4)
F1773			W4C (2)(4)	W4C (1)(4)	W4C (1)(4)	W4C (1)(4)

Notes

- (1) No risk
- (2) Risk for parameter change if PSL is not strictly followed
- (3) Risk for product damage if PSL is not strictly followed
- (4) C: The component has a preheat limitation of 150 °C
- (5) Y: Temperature is measured at the body top and must be kept as follows:
 During preheating: $T_{max.} \leq 125\text{ °C}$
 During soldering: $T_p \leq 135\text{ °C}$, $t_p \leq 30\text{ s}$, $t \leq 50\text{ s}$

AXIAL POLYPROPYLENE TYPES

FAMILY	PRODUCT BODY LENGTH					
	11 mm	14 (17) mm	19 (22) mm	26.5 (29) mm	31.5 (34) mm	41.5 (44) mm
MKP 1839/MKP 1839 HQ	W4Y (3)(4)	W4Y (3)(4)	W4Y (3)(5)	W4Y (2)(5)	W4Y (1)(5)	W4Y (1)(5)
MKP 1845		W4Y (3)(4)	W4Y (3)(5)	W4Y (2)(5)	W4Y (1)(5)	W4Y (1)(5)

Notes

- (1) No risk
- (2) Risk for parameter change if PSL is not strictly followed
- (3) Risk for product damage if PSL is not strictly followed
- (4) Y: Temperature is measured at the body top and must be kept as follows:
 During preheating: $T_{max.} \leq 100\text{ °C}$
 During soldering: $T_p \leq 110\text{ °C}$, $t_p \leq 20\text{ s}$, $t \leq 30\text{ s}$
- (5) Y: Temperature is measured at the body top and must be kept as follows:
 During preheating: $T_{max.} \leq 110\text{ °C}$
 During soldering: $T_p \leq 120\text{ °C}$, $t_p \leq 20\text{ s}$, $t \leq 30\text{ s}$

WARNINGS

Excessive soldering heat (preheating or soldering above the recommended limits) can result in product damage and malfunctioning and should be thus strictly avoided. If PSL limits have been exceeded at any point in time during the soldering process, the products could possibly show a change in certain parameters (e.g. capacitance value, $\tan \delta$, insulation resistance, breakdown level, etc.) Exceeding PSL limits can even result in destruction of the product. Warning signs include a bulged or deformed product encapsulation. Such an appearance may also be the result of other causes, such as interruptions, cooling malfunctioning of the soldering machine, etc.

Axial components can better protected from direct heat conducted by the PCB, when a distance is kept from the product to the PCB as follows:

